

Work Order ID 120871

June-12-14 9:45:30 AM

\*120871\*

Page 1

Item ID: D407-667-105TRN

Accept

\*N900040100\*

Setup Start

\*NS1\*

Revision ID:

Item Name: Crosstube Turning Detail

Stop

\*NS2\*

Start Date: 6/12/14 Start Qty: 1.00

\*1\*

Cust Item ID:

Required Date: 6/12/14 Req'd Qty: 1.00

\*1\*

Customer:

Reference:

Approvals: Process Plan: MS

Date: 1406-12

Tooling:

Date:

Run

Start

\*NR1\*

QC:

Date:

SPC (Y/N):

Date:

Stop

\*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

D407-667-145

Rev C

100

0.00

\*100\*

MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

0.00

Mori Seiki CNC Lathe Large

1-Fill tube with sand & install plugs DT8673 on both ends as per Folio FA249

2-Turn first side as per Folio FA249

3-Blend transition lines only, \*\*do not sand whole tube\*\*:

FOLIO REV: AA

DWG REV: C

\*Use mill bastard file, brush file repeatedly with file card.

\*Do not use sandpaper coarser than 320 grit.

110

QC1- Inspect dimensions to dimension sheet

0.00

\*110\*

QC

Memo

0.00

Quality Control

manil  
14/06/23

manil  
14/06/23

Work Order ID 120871

June-12-14 9:45:30 AM

\*120871\*

Page 2

Item ID: D407-667-105TRN

Accept

\*N900040100\*

Setup Start \*NS1\*

Revision ID:

Stop \*NS2\*

Item Name: Crosstube Turning Detail

Start Date: 6/12/14

Start Qty: 1.00

\*1\*

Cust Item ID:

Required Date: 6/12/14

Req'd Qty: 1.00

\*1\*

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start \*NR1\*

QC:

Date:

SPC (Y/N):

Date:

Stop \*NR2\*

Sequence ID/  
Work Center IDOperation  
DescriptionSet Up/  
Run Hours

Tool ID

Tool #

Plan  
CodeAccept  
QtyReject  
QtyReject  
NumberInsp.  
Stamp

120

0.00

\*120\*

MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

0.00

Mori Seiki CNC Lathe Large

1-Turn second side as per Folio FA249

2-Blend transition lines only, \*\*do not sand whole tube\*\*:

\*Use mill bastard file, brush file repeatedly with file card.

\*Do not use sandpaper coarser than 320 grit.

FOLIO REV: AADWG REV: C

3-Remove sand and plugs

4-Scribe part # and batch # using vibrating stylus as per Dwg D206-667-145  
inside of Cuff(Do not engrave on outside of tube)

130

0.00

\*120\*

QC1- Inspect dimensions to dimension sheet

QC

Memo

0.00

Quality Control

mm L  
14/06/24mm L  
14/06/24

# Work Order ID 120871

June-12-14 9:45:30 AM

**\*120871\***

Page 3

Item ID: D407-667-105TRN

Accept

**\*N900040100\***

Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Crosstube Turning Detail

Start Date: 6/12/14 Start Qty: 1.00 **\*1\***

Cust Item ID:

Required Date: 6/12/14 Req'd Qty: 1.00 **\*1\***

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start **\*NR1\***

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
140	QC8- Inspect parts - second check	0.00							
<b>*140*</b>									
QC	Memo	0.00							JW 14-06-26
Quality Control									
145		0.00							
<b>*145*</b>									
Crosstubes	Memo	0.00							DL 14/06/26
Crosstubes	GRIND ONLY TRANSITION LINES SMOOTH LONGITUDE WAY.								
150		0.00							
<b>*150*</b>									
HandFXtube	Memo	0.00							BL/DL 14-06-26
Hand Finishing Crosstubes	1- PRESSURE WASH X-TUBE INSIDE AND OUT								
	2- ACID ETCH X-TUBE INSIDE AND OUT. USE RED SCOTCH BRITE								

# Work Order ID 120871

June-12-14 9:45:30 AM

**\*120871\***

Page 4

Item ID: D407-667-105TRN

Accept

**\*N900040100\***

Setup Start

**\*NS1\***

Revision ID:

Item Name: Crosstube Turning Detail

Stop

**\*NS2\***

Start Date: 6/12/14

Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 6/12/14

Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run

Start

**\*NR1\***

QC:

Date:

SPC (Y/N):

Date:

Stop

**\*NR2\***

Sequence ID/  
Work Center ID

Operation  
Description

Set Up/  
Run Hours

Tool ID

Tool #

Plan  
Code

Accept  
Qty

Reject  
Qty

Reject  
Number

Insp.  
Stamp

160

QC5- Inspect part completeness to step on W/O

0.00

DAS  
16  
9-89

14/06/26

**\*160\***

QC

Memo

0.00

Quality Control

170

Packaging

0.00

**\*170\***

Packaging

Memo

0.00

Packaging

Identify and stock in Kanban rackLocation:

LC

DC 14/06/26

180

QC21- Final Inspection - Work Order Release

0.00

**\*180\***

QC

Memo

0.00

Quality Control

ML 14-06-27

MF  
14-6-29


<b>DART AEROSPACE LTD</b>		<b>Work Order:</b> 120871
<b>Description:</b> Crosstube Assembly		<b>Part Number:</b> D407-667-145
<b>Inspection Dwg:</b> D407-667-145 Rev: C		<b>Page 1 of 2</b>

### FIRST ARTICLE INSPECTION CHECKLIST

	Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.240	+0.005/-0.000	2.241	/		vern	CNC-08
	1.865	+0.005/-0.000	1.867	/			
	1.878	+0.005/-0.000	1.878	/			
	1.970	+0.005/-0.000	1.974	/			
	2.030	+0.005/-0.000	2.035	/			
	2.165	+0.005/-0.000	2.170	/			
	0.125	+/-0.010	.125	-		vern	CNC-08
	R0.063	+/-0.010	.063	-		RG	
	R0.500	+/-0.010	.500	-		II	
	R0.063	+/-0.010	.063	-		VI	
	4.438	+/-0.030	4.435	-		vern	CNC-08
SIDE B	2.240	+0.005/-0.000	2.241	/		vern	CNC-08
	1.865	+0.005/-0.000	1.867	/			
	1.878	+0.005/-0.000	1.878	/			
	1.970	+0.005/-0.000	1.973	/			
	2.030	+0.005/-0.000	2.035	/			
	2.165	+0.005/-0.000	2.170	/			
	0.125	+/-0.010	.125	-		vern	CNC-08
	R0.063	+/-0.010	.063	-		RG	
	R0.500	+/-0.010	.500	/		II	
	R0.063	+/-0.010	.063	/		VI	
	4.438	+/-0.030	4.435	-		vern	CNC-08
	113.20	+/-0.020	113.190	-		tape	LG-11

<b>DART AEROSPACE LTD</b>		<b>Work Order:</b>	120871
<b>Description:</b> Crosstube Assembly		<b>Part Number:</b>	D407-667-145
<b>Inspection Dwg:</b> D407-667-145 Rev: C		<b>Page 2 of 2</b>	

### WALL THICKNESS MEASUREMENT

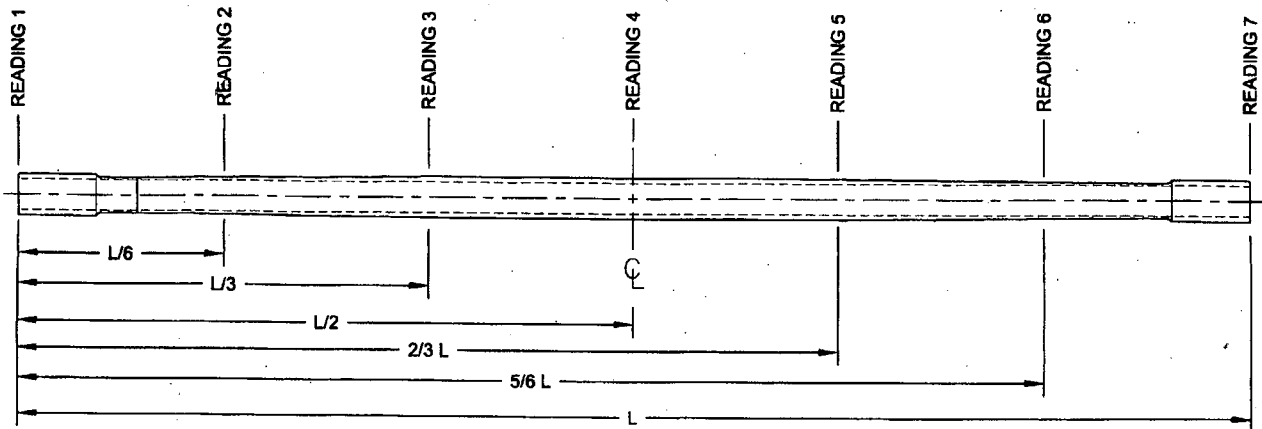

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation $\Delta w$ (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L= 0"	.319	.324	.319	.320	.005	0.042"
READING 2 L= 19	.187	.182	.176	.181	.011	
READING 3 L= 37.5	.263	.275	.266	.276	.017	
READING 4 L= 56.5	.328	.319	.323	.325	.009	
READING 5 L= 75.5	.275	.272	.278	.280	.008	
READING 6 L= 94	.180	.169	.190	.197	.021	
READING 7 L= 113.20	.323	.317	.321	.318	.006	

#### Calibration Result

Actual Block Thickness: .100 - .750

Situscan 250 Measured Thickness: .160 - .750

<b>Measured by:</b>	mm.l
<b>Date:</b>	14/06/25

<b>Audited by:</b>	JW
<b>Date:</b>	14-06-26

<b>Preliminary Approval:</b>	
<b>Date:</b>	

Rev	Date	Change	Revised by	Approved
A	04.04.21	New Issue (P/O D407-667-105)	KJ/RF	
B	06.03.09	Dwg Rev updated	KJ/JLM	
C	09.06.11	Dwg Rev updated	KJ	
D	11.06.21	Tolerance revised for 4.438 dimension	KJ	
E	12.06.04	Wall thickness form added	KJ	

Item	Qty -145	Part Number	Description
1	X	D407-667-145	CROSSTUBE ASSEMBLY (407 HIGH FWD)
2	1	D6010-115	CROSSTUBE
3	2	D2873-043	NUT PLATE
4	2	D2873-045	NUT PLATE
5	2	D2891-1	SUPPORT
6	4	D3595-063-395	RUBBER CUSHION
7	4	MS21920-20	CLAMP (OR MS21920-21)
8	14	MS20601AD4W10	RIVET (OR NAS9302B-4-10)
9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299- 947-100, TYPE II, CLASS 2 ADHESIVE)

# **GENERAL NOTES:**

- 1) MATERIAL: MANUFACTURED FROM D6010-115  
FINISHED LENGTH = 113.20±0.020
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D407-667-145" AND BATCH NUMBER ON  
INSIDE OF CUFF USING VIBRATING STYLUS.
- 7) WEIGHT: 17.8 lbs
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN CUTTER OFF PART WHERE INDICATED. BLEND OUT EDGE LONGITUDINALLY,  
TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 6 PASSES. MAXIMUM TUBE FLATTENING DUE  
TO BENDING IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2891-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER  
QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-20 CLAMPS (OR -21) WITH D3595-063-395 RUBBER CUSHIONS TO SECURE  
THE D2891-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMP MECHANISMS  
ARE LOCATED ON CROSSTUBE SUPPORTS.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE  
OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS  
SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT  
LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN  
SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

SHU COPY

RE COPY

UNC COPY

SHU COPY

NO. 120871 MJS  
1406-72

DEO ATTACHED


ECW #11-615

11.07.26

UNDER REVIEW

RELEASED  
08/11/12

C	REVISE GENERAL NOTES/PART LIST (ZN D7-1); REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS. D3595-063-395 WAS D2858-400-694 (ZN D6-2 & A5-2); REMOVED REF. 7 ADD TOLERANCES (ZN C6-3, C4-3, D2-3); RELOCATED FLAG #6 (ZN A8-3) PER NCR 210; MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4.	RF	08.11.06
B	ADD HOLES AND NUT PLATES FOR COMPATABILITY WITH BHT/AA SKUDTUBES	PH	05.07.26
A	NEW ISSUE	CP	02.05.08
REV.	DESCRIPTION	BY	DATE
DESIGN	RF	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	RF	DRAWING NO.	REV. C
CHECKED	RF	D407-667-145	SHEET 1 OF 4
MFG. APPR.	RF	TITLE	SCALE
APPROVED	RF	CROSSTUBE ASS'Y (407 HIGH FWD)	NTS
DE APPR.	RF	COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED BY THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	
DATE	08.11.06		

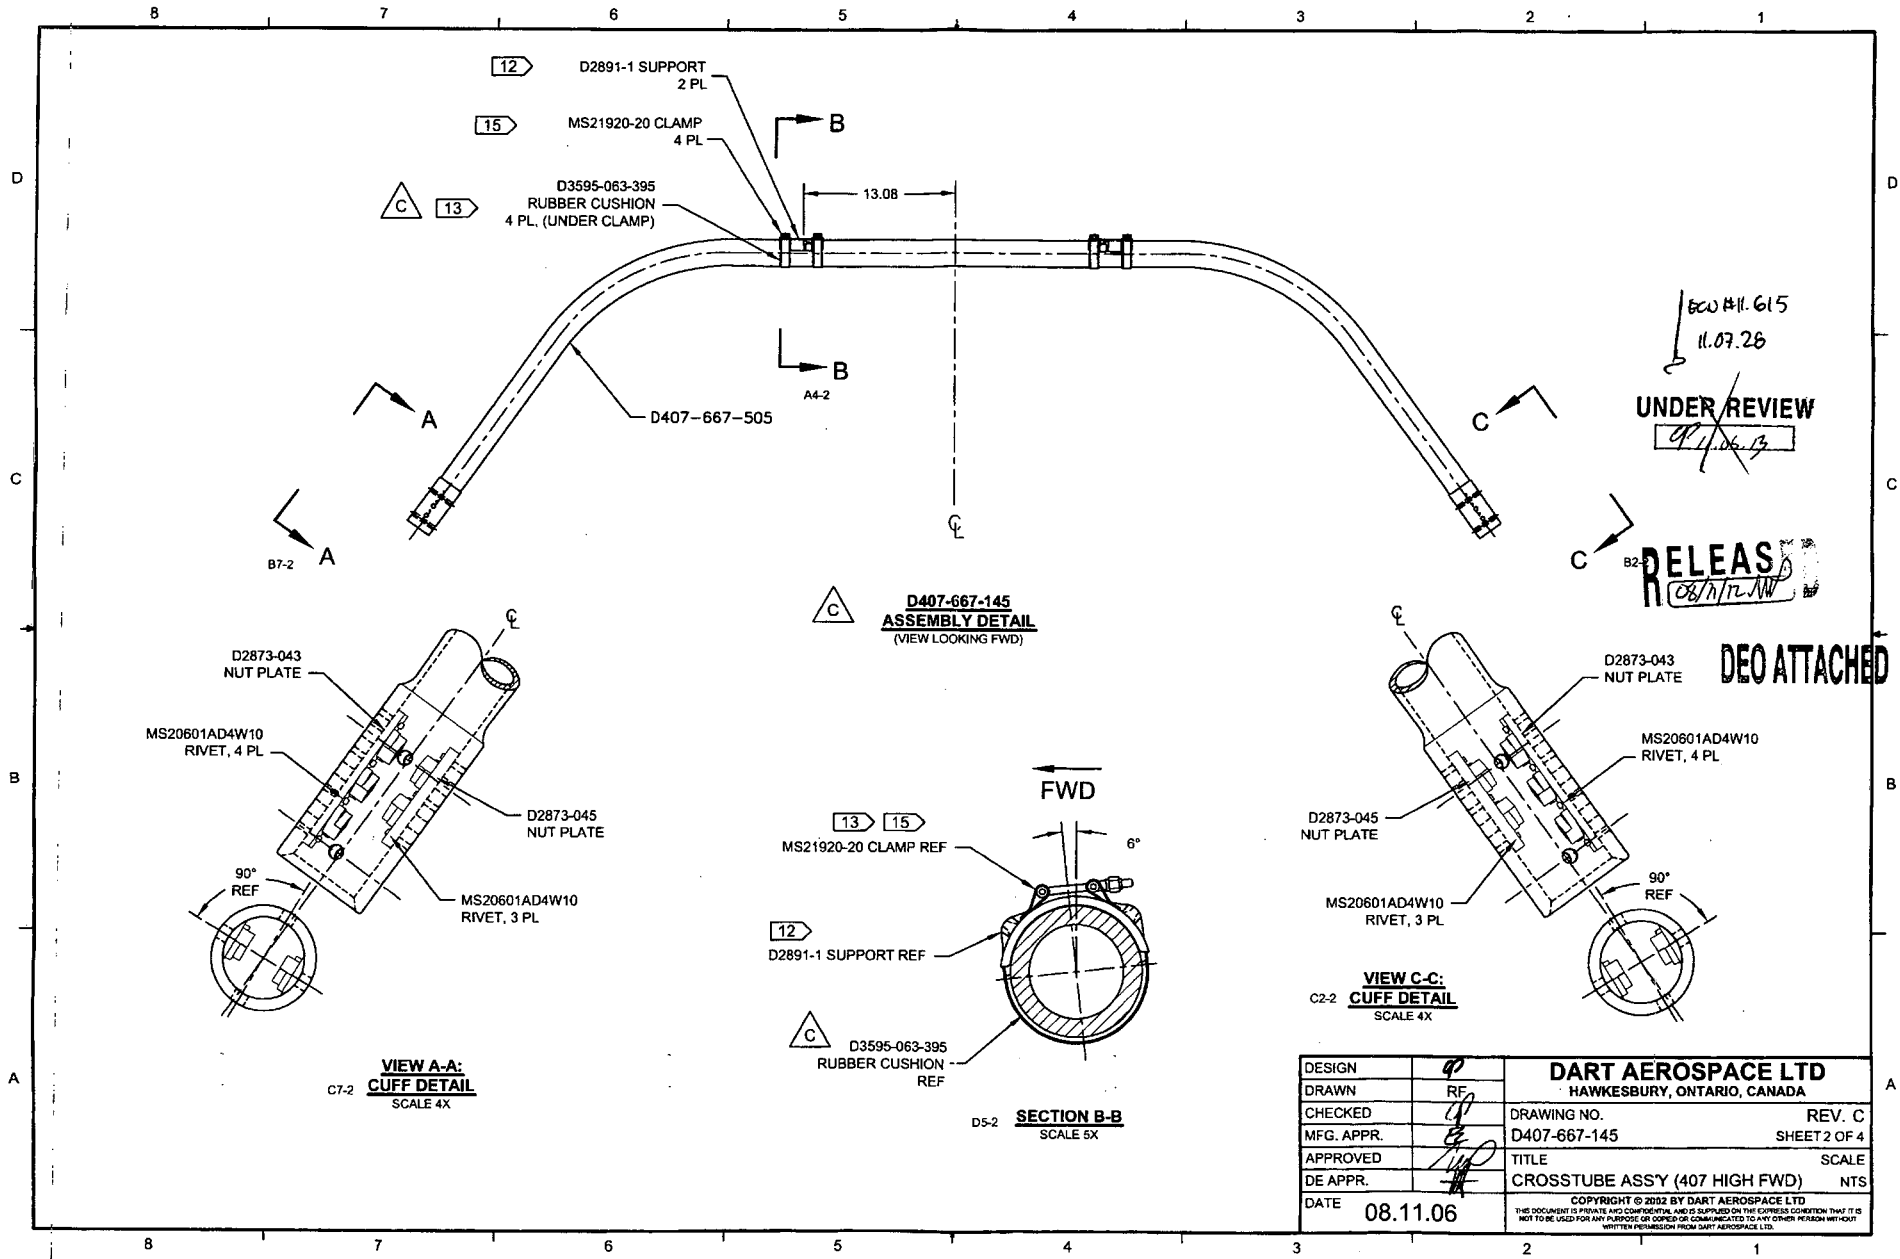

ECN #11.615  
11.07.26

**UNDER REVIEW**  
9/1/06

**RELEASE**  
08/11/06

**DEO ATTACHED**

DESIGN	9	<b>DART AEROSPACE LTD</b>	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	4	DRAWING NO.	REV. C
MFG. APPR.	4	D407-667-145	SHEET 2 OF 4
APPROVED	4	TITLE	SCALE
DE APPR.	4	CROSSTUBE ASSY (407 HIGH FWD)	NTS
DATE	08.11.06	COPYRIGHT © 2002 BY DART AEROSPACE LTD <small>THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	




UNDER REVIEW


CP 11.08.13

600 H11.615


1.07.28

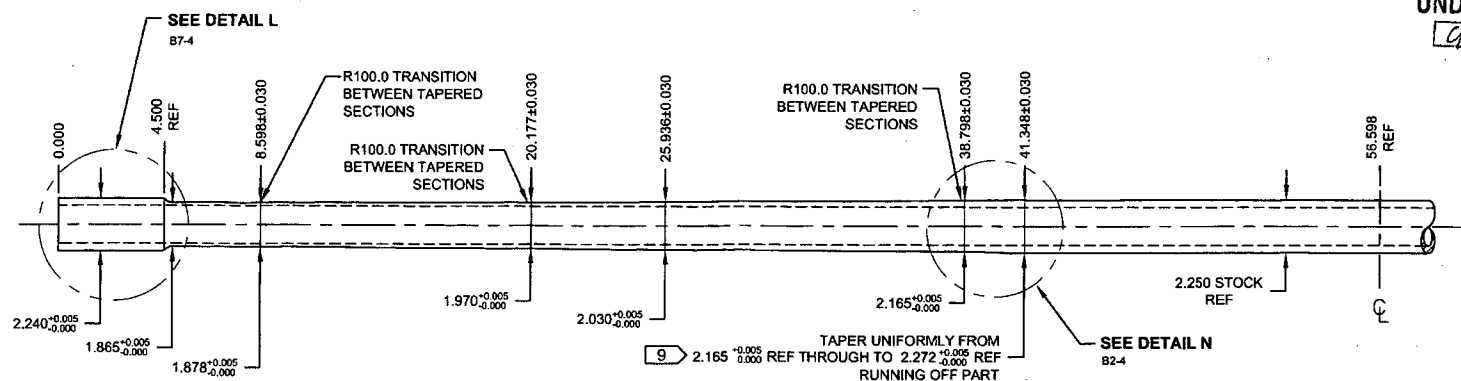


**C TURNING DETAIL**

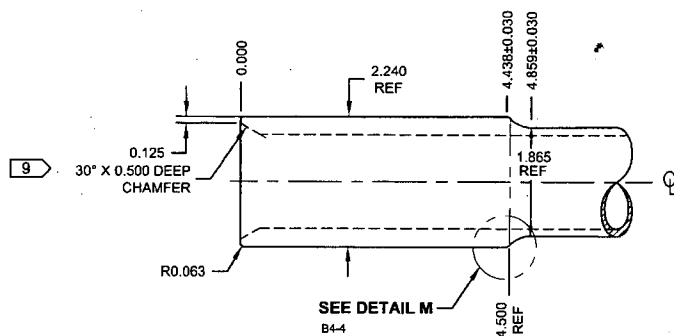

**DETAIL L:  
CROSSTUBE CUFF**  
D7-4  
NOT TO SCALE

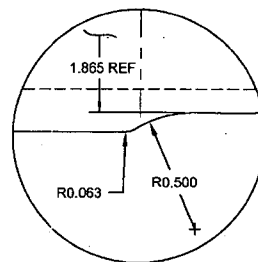

**DETAIL M:  
CUFF TRANSITION**  
D6-4  
NOT TO SCALE

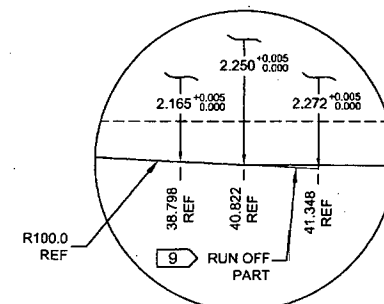

**DETAIL N:  
TAPER RUN-OFF**  
C3-4  
NOT TO SCALE

DEO ATTACHED

RELEASED

DESIGN	9	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	CP	DRAWING NO.	REV. C
MFG. APPR.	CP	D407-667-145	SHEET 4 OF 4
APPROVED	CP	TITLE	SCALE
DE APPR.	CP	CROSSTUBE ASS'Y (407 HIGH FWD)	NTS
DATE	08.11.06	COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DRAWING NO. D407-667-145	TITLE CROSSTUBE ASS'Y (407 HIGH FWD)	REV. C	<b>DART AEROSPACE LTD ENGINEERING ORDER</b>		D.E.O. NO. D407-667-145-C-1	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>q</i>	CHECKED <i>ASS</i>	MFG. APPR. <i>KB</i>	APPROVED <i>WD</i>		DE APPR. <i>##</i>		
DATE 11.07.15	DATE 11.07.22	DATE 11.07.22	DATE 11/07/22		DATE 11.07.21		

**PURPOSE:**

REPLACE MAGNOBOND WITH PROSEAL.

**CHANGE:**

IS:

Item	Qty -145	Part Number	Description
9	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

WAS:

9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
---	-----	----------------	---

NOTE 12 & 15, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 12) TO INSTALL D2891-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. **PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.**

WAS:

- 12) INSTALL D2891-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

**RELEASED**  
2011-07-28  
*WD*

DRAWING NO. D407-667-145	TITLE CROSSTUBE ASS'Y (407 HIGH FWD)	REV. C	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D407-667-145-C-2	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN AJS	CHECKED [Signature]	MFG. APPR. [Signature]	APPROVED [Signature]		DE APPR. [Signature]		
DATE 12.08.02	DATE 12.08.02	DATE 12.08.02	DATE 12.08.02		DATE 12.08.02		

**PURPOSE:**

ADD ELECTRICAL GROUNDING STRAP

**CHANGE:**

ITEM	QTY	PART NUMBER	DESCRIPTION
1	X	D407-667-145	CROSSTUBE ASSEMBLY (407 HIGH FWD)
10	2	AN742D36	CLAMP
11	2	MS9165-05	ANGLE BRACKET
12	2	MS21042L3	NUT (OR MS21042-3)
13	2	MS27039-1-08	SCREW
14	4	NAS1149C0332R	WASHER (OR AN960C10L)


ADD

**GENERAL NOTES:**


- 16) MASK AREA UNDER CLAMP PRIOR TO PAINTING
- 17) SEAL EDGES WHERE AN742D36 CLAMP MEETS WITH THE CROSSTUBE USING SIKAFLEX-241/-291 OR MIL-S-8802 CLASS B2 OR PROSEAL 890 SEALANT
- 18) PERFORM RESISTANCE CHECK TO ENSURE MAX RESISTANCE IS 10 MILLIOHMS

ADD

**RELEASED**  
CP 12.08.17  
ECN 12-631

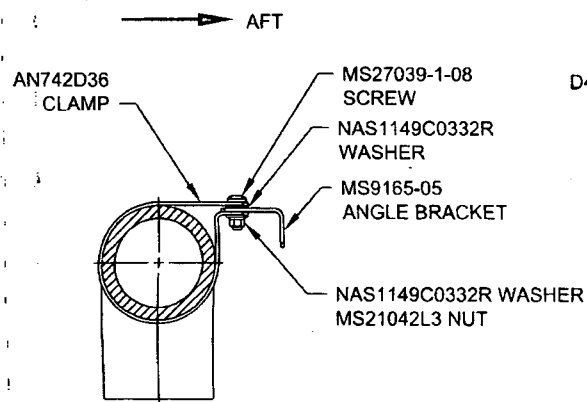

**SECTION R-R**

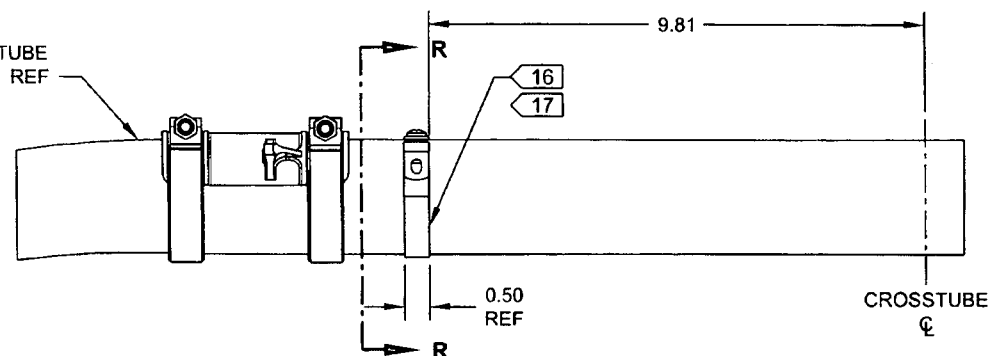

**DETAIL P**  
BONDING STRAP INSTALLATION 2 PL

